RESERVE STUDY

PREPARED FOR:

Seven Lakes Golf and Tennis Community Condo 46

Fort Myers, FL



For The Period Beginning April 1, 2025 PREPARED BY:



260 1st Ave South, STE 225 St. Petersburg, FL 33701 1-800-892-1116 www.stonebldg.com



Stone Building Solutions

reserves@stonebldg.com www.stonebldg.com 1-800-892-1116

Attention: Board of Directors

Property: Seven Lakes Golf and Tennis Community Condo 46, Fort Myers, Florida

Service: Traditional Reserve Study Period: Beginning April 1, 2025

December 15, 2024

Dear Board of Directors of Seven Lakes Golf and Tennis Community Condo 46:

At the direction of the Board and management of Seven Lakes Golf and Tennis Community Condo 46,

Stone Building Solutions has completed a Traditional Reserve Study for the Seven Lakes Golf and Tennis Community Condo 46 Association. Enclosed is our report for the Board's review and consideration.

This study is based on an on-site analysis. The on-site analysis of Seven Lakes Golf and Tennis Community Condo 46 upon which this study is based was performed by of Stone Building Solutions.

The effective date of this report is the date of inspection, June 4, 2024

This Reserve Study meets or exceeds all requirements outlined in Florida Statute 718.112 and the Association of Professional Reserve Analysts (APRA) standards fulfilling the requirements of a "Level I Reserve Study."

If you have any questions or would like to direct any follow-up service, please don't hesitate to contact us.

Respectfully submitted,

Stone Building Solutions

Summer Megdadi

Summer Megdadi, RS

Reserve Specialist #411 Summer Reserves@stonebldg.com Megdadi

Table of Contents

xecutive Summary	4
Cost Evaluation	6
xpenditures	7
xpenditures (By Year)	9
Pooling Methodology	14
Cash Flow Analysis	15
Charts & Graphs	17
unding Options	18
Reserve Component Summary	20
Component Details	21
Definitions	32
Disclosures	35
lpdate Service	36



Executive Summary

The purpose of this reserve study is to produce a reserve funding plan that will project future contributions and expenditures to ensure that reserve funds are available as needed.

Stone Building Solutions was responsible for the physical evaluation. Stone Building Solutions provided analysis on key building components, their condition, and evaluation. Stone Building Solutions has received this information 'as is' and is not in a position to add or comment on the engineering analysis. Stone Building Solutions is using this information to create a financial evaluation for budgeting purposes.

Seven Lakes Golf and Tennis Community Condo 46 has 48 units. This study is for the fiscal year starting April 1, 2025, and ending Mar 31, 2026.

Financial Parameters & Assumptions

Projection Period:	April 1, 2025 - March 31, 2055	Report Type:	Type 1
Inflation:	2.50%	Association:	Condominium
Annual Percent Contribution Change:	3.00%	Buildings:	1
Interest (Gained):	1.00%	Total Units:	48
		Year Built:	1975

As of April 1, 2025, the estimated unaudited reserve fund balance is \$274,031

The estimated current replacement cost of the reserve items is \$511,088

30-Year Pooled Cash Flow Funding Analysis Summary - (Future Cost):

The 30-year Funding Plan is an approach to determining reserve contributions in a way that balances the annual expenses from the reserve fund. This analysis takes into account future replacement costs for reserve components as they come due for replacement, acknowledges construction cost increases, and considers interest income generated by reserve accounts. By pooling funds from initial balances, a yearly contribution rate is calculated to ensure a positive cash flow throughout the analysis period. This funding plan requires level contributions to Reserves over the projected period.

Powered by HomeRun IQ Page 4 of 36

The recommendations for the initial year are based on the 30-year Pooled Cash Flow Funding Plan.

Recommended annual contribution: \$29,500

Recommended annual contribution per unit: \$615

First Year monthly contribution per unit: \$51

Average monthly contribution per unit (Over 30 Years): \$81

Special assessments: \$0

Powered by HomeRun IQ Page 5 of 36



Cost Evaluation

The cost estimates identified are based on approximate quantities, costs, and published information, and they include labor, material, design fees, appropriate overhead, general conditions, and profit. The estimated costs to repair, replace, or upgrade the improvements are considered typical for the marketplace.

No contractors have been contacted for actual bids or price quotes, and the actual cost of repairs may vary from our estimates. These opinions of probable costs are for components or systems exhibiting material deferred maintenance, and for existing physical deficiencies requiring major repairs or replacement.

This report presents the 30 Year Cash Flow Funding Analysis.

The 30-year Pooled Cash Flow Funding Plan is a method of calculating reserve contributions where contributions to the reserve funds are designed to offset the variable annual expenditures from the reserve fund. Funds from the beginning balances are pooled together and a yearly contribution rate is calculated to arrive at a positive cash flow throughout the analysis period.

Powered by HomeRun IQ Page 6 of 36



Expenditures

Individual Elements

ASSET №	NAME	NEXT ACTIVITY	est Life	ADJ LIFE	rem Useful Life	UNIT COST	QTY	YEAR 1 REPLACEMENT COST
	SIRS and TRS Yearly Update: Update	04/01/2025	1y	1y 3m	Оу	\$1,894.20	1 LS	\$1,894
001	Asphalt Pavement, Mill & Overlay: Common	04/01/2030	25y	20y	5у	\$21.525	2,724 SY	\$58,634
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	04/01/2027	5у	5у	2y	\$0.461	24,520 SF	\$11,304
003	Elevator Cabs, Refurbish Part 1: Common	04/01/2025	20y	7y	0y	\$36,900.00	1 Ea	\$36,900
003	Elevator Cabs, Refurbish Part 2: Common	04/01/2030	20y	12y	5у	\$44,280.00	1 Ea	\$44,280
004	Elevators, 3-Stop, Hydraulic, Modernization : Common	04/01/2035	36y	27y	10y	\$194,750.00	1 Ea	\$194,750
005	Furniture, Outdoor: Common	04/01/2032	10y	10y	7у	\$5,637.50	1 Allow	\$5,638
006	Gutters & Downspouts, 6" Aluminum: Common	04/01/2030	30y	23y	5у	\$13.838	2,200 LF	\$30,444
007	Light Fixtures, Exterior: Common	04/01/2030	15y	15y	5у	\$252.15	60 Ea	\$15,129
008	Mailbox Clusters, Aluminum, Multi-Tenant: Common	04/01/2030	25y	25y	5y	\$3,546.50	3 Ea	\$10,640
010	Pavers, Concrete, Walkways: Common	04/01/2035	35y	35y	10y	\$15.375	6,600 SF	\$101,475

\$511,088

Powered by HomeRun IQ Page 7 of 36



Critical Expenditure Planning (3-Year Outlook)

LOCATION RESERVE ITEM	2025	2026	2027
Building Service Components			
Total Building Service			
Components			
Exterior Building Components			
Total Exterior Building			
Components			
General			
SIRS and TRS Yearly Update:	\$1,942	\$1,990	\$2,040
Update	\$1,942	0FE,1 &	\$2,040
Total General	\$1,942	\$1,990	\$2,040
Interior Building Components			
Elevator Cabs, Refurbish Part	\$36,900		
1: Common	\$30,900		
Total Interior Building	\$36,900		
Components	\$30,900		
Property Site Components			
Asphalt Pavement, Patch,			¢11.060
Stripe & Sealcoat: Common			\$11,868
Total Property Site Components			\$11,868
Total	\$38,842	\$1,990	\$13,908

Powered by HomeRun IQ Page 8 of 36



Expenditures (By Year)

ASSET №	NAME	UNIT COST	QTY.	FUTURE COST	USEFUL LIFE	NEXT ACTIVITY
2025-26 (Yea	ur 1)					
003	Elevator Cabs, Refurbish Part 1: Common	\$36,900.00	1 Ea	\$36,900	7у	2045-46
	SIRS and TRS Yearly Update: Update	\$1,942.00	1 LS	\$1,942	1у	2026-27
2025-26 (Yea	ur 1) Total			\$38,842		
2026-27 (Yea	ur 2)					
	SIRS and TRS Yearly Update: Update	\$1,990.00	1 LS	\$1,990	1у	2027-28
2026-27 (Yea	ır 2) Total			\$1,990		
2027-28 (Yea	ır 3)					
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	\$0.484	24,520 SF	\$11,868	5y	2032-33
	SIRS and TRS Yearly Update: Update	\$2,040.00	1 LS	\$2,040	1у	2028-29
2027-28 (Year 3) Total				\$13,908		
2028-29 (Yea	ır 4)					
	SIRS and TRS Yearly Update: Update	\$2,091.00	1 LS	\$2,091	1у	2029-30
2028-29 (Yea	ur 4) Total			\$2,091		
2029-30 (Yea	ur 5)					
	SIRS and TRS Yearly Update: Update	\$2,143.00	1 LS	\$2,143	1у	2030-31
2029-30 (Yea	ır 5) Total			\$2,143		
2030-31 (Yea	ır 6)					
001	Asphalt Pavement, Mill & Overlay: Common	\$24.354	2,724 SY	\$66,340	20y	N/A
003	Elevator Cabs, Refurbish Part 2: Common	\$50,099.00	1 Ea	\$50,099	12y	2050-51
006	Gutters & Downspouts, 6" Aluminum: Common	\$15.656	2,200 LF	\$34,443	23y	N/A
007	Light Fixtures, Exterior: Common	\$285.283	60 Ea	\$17,117	15y	2045-46

Powered by HomeRun IQ Page 9 of 36

ASSET №	NAME	UNIT COST	QTY.	FUTURE COST	USEFUL LIFE	NEXT ACTIVITY
800	Mailbox Clusters, Aluminum, Multi-Tenant: Common	\$4,012.667	3 Ea	\$12,038	25y	N/A
	SIRS and TRS Yearly Update: Update	\$2,197.00	1 LS	\$2,197	1y	2031-32
2030-31 (Year 6) Total			\$182,234		
2031-32 (Year 7))					
	SIRS and TRS Yearly Update: Update	\$2,252.00	1 LS	\$2,252	1y	2032-33
2031-32 (Year 7)	') Total			\$2,252		
2032-33 (Year 8))					
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	\$0.548	24,520 SF	\$13,437	5у	2037-38
005	Furniture, Outdoor: Common	\$6,701.00	1 Allow	\$6,701	10y	2042-43
	SIRS and TRS Yearly Update: Update	\$2,308.00	1 LS	\$2,308	1у	2033-34
2032-33 (Year 8)	r) Total			\$22,446		
2033-34 (Year 9))					
	SIRS and TRS Yearly Update: Update	\$2,366.00	1 LS	\$2,366	1у	2034-35
2033-34 (Year 9)) Total			\$2,366		
2034-35 (Year 1	0)					
	SIRS and TRS Yearly Update: Update	\$2,425.00	1 LS	\$2,425	1у	2035-36
2034-35 (Year 1	0) Total			\$2,425		
2035-36 (Year 1	1)					
004	Elevators, 3-Stop, Hydraulic, Modernization : Common	\$249,296.00	1 Ea	\$249,296	27y	N/A
010	Pavers, Concrete, Walkways: Common	\$19.681	6,600 SF	\$129,895	35y	N/A
	SIRS and TRS Yearly Update: Update	\$2,485.00	1 LS	\$2,485	1у	2036-37
2035-36 (Year 1	1) Total			\$381,676		
2036-37 (Year 1	2)					
	SIRS and TRS Yearly Update: Update	\$2,547.00	1 LS	\$2,547	1у	2037-38
2036-37 (Year 1	2) Total			\$2,547		
2037-38 (Year 1	3)					
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	\$0.62	24,520 SF	\$15,202	5у	2042-43

Powered by HomeRun IQ Page 10 of 36

ASSET №	NAME	UNIT COST	QTY.	FUTURE COST	USEFUL LIFE	NEXT ACTIVITY
	SIRS and TRS Yearly Update: Update	\$2,611.00	1 LS	\$2,611	1у	2038-39
2037-38 (Year	13) Total			\$17,813		
2038-39 (Year	14)					
	SIRS and TRS Yearly Update: Update	\$2,676.00	1LS	\$2,676	1у	2039-40
2038-39 (Year	14) Total			\$2,676		
2039-40 (Year	15)					
	SIRS and TRS Yearly Update: Update	\$2,743.00	1 LS	\$2,743	1у	2040-41
2039-40 (Year	15) Total			\$2,743		
2040-41 (Year	16)					
	SIRS and TRS Yearly Update: Update	\$2,812.00	1LS	\$2,812	1у	2041-42
2040-41 (Year	16) Total			\$2,812		
2041-42 (Year	17)					
	SIRS and TRS Yearly Update: Update	\$2,882.00	1 LS	\$2,882	1у	2042-43
2041-42 (Year	17) Total			\$2,882		
2042-43 (Year	18)					
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	\$0.701	24,520 SF	\$17,189	5y	2047-48
005	Furniture, Outdoor: Common	\$8,578.00	1 Allow	\$8,578	10y	2052-53
	SIRS and TRS Yearly Update: Update	\$2,954.00	1 LS	\$2,954	1у	2043-44
2042-43 (Year	18) Total			\$28,721		
2043-44 (Year	19)					
	SIRS and TRS Yearly Update: Update	\$3,028.00	1 LS	\$3,028	1у	2044-45
2043-44 (Year	19) Total			\$3,028		
2044-45 (Year	20)					
	SIRS and TRS Yearly Update: Update	\$3,104.00	1LS	\$3,104	1у	2045-46
2044-45 (Year	20) Total			\$3,104		
2045-46 (Year	21)					
003	Elevator Cabs, Refurbish Part 1: Common	\$60,465.00	1 Ea	\$60,465	20y	N/A
007	Light Fixtures, Exterior: Common	\$413.183	60 Ea	\$24,791	15y	N/A

Powered by HomeRun IQ Page 11 of 36

ASSET №	NAME	UNIT COST	QTY.	FUTURE COST	USEFUL LIFE	NEXT ACTIVITY
	SIRS and TRS Yearly Update: Update	\$3,181.00	1 LS	\$3,181	1у	2046-47
2045-46 (Year	21) Total			\$88,437		
2046-47 (Year	22)					
	SIRS and TRS Yearly Update: Update	\$3,261.00	1 LS	\$3,261	1у	2047-48
2046-47 (Year	22) Total			\$3,261		
2047-48 (Year	23)					
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	\$0.794	24,520 SF	\$19,469	5у	2052-53
	SIRS and TRS Yearly Update: Update	\$3,343.00	1 LS	\$3,343	1у	2048-49
2047-48 (Year	23) Total			\$22,812		
2048-49 (Year	24)					
	SIRS and TRS Yearly Update: Update	\$3,426.00	1 LS	\$3,426	1у	2049-50
2048-49 (Year	24) Total			\$3,426		
2049-50 (Year	25)					
	SIRS and TRS Yearly Update: Update	\$3,512.00	1 LS	\$3,512	1у	2050-51
2049-50 (Year	25) Total			\$3,512		
2050-51 (Year	26)					
003	Elevator Cabs, Refurbish Part 2: Common	\$82,093.00	1 Ea	\$82,093	20y	N/A
	SIRS and TRS Yearly Update: Update	\$3,600.00	1 LS	\$3,600	1у	2051-52
2050-51 (Year	26) Total			\$85,693		
2051-52 (Year	27)					
	SIRS and TRS Yearly Update: Update	\$3,690.00	1 LS	\$3,690	1у	2052-53
2051-52 (Year	27) Total			\$3,690		
2052-53 (Year	28)					
002	Asphalt Pavement, Patch, Stripe & Sealcoat: Common	\$0.898	24,520 SF	\$22,019	5y	N/A
005	Furniture, Outdoor: Common	\$10,981.00	1 Allow	\$10,981	10y	N/A
	SIRS and TRS Yearly Update: Update	\$3,782.00	1 LS	\$3,782	1у	2053-54
2052-53 (Year	28) Total			\$36,782		
2053-54 (Year	29)					

Powered by HomeRun IQ Page 12 of 36

ASSET №	NAME	UNIT COST	QTY.	FUTURE COST	USEFUL LIFE	NEXT ACTIVITY
	SIRS and TRS Yearly Update: Update	\$3,876.00	1 LS	\$3,876	1у	2054-55
2053-54 (Year	r 29) Total			\$3,876		
2054-55 (Year	r 30)					
	SIRS and TRS Yearly Update: Update	\$3,973.00	1 LS	\$3,973	1у	N/A
2054-55 (Year	r 30) Total			\$3,973		

Powered by HomeRun IQ Page 13 of 36



Pooled/Cash-Flow Funding (30-Year Projection)

This part of the Reserve Study introduces an alternative approach to funding compared to the Component Funding Analysis (Straight-Line).

This method entails computing the yearly Reserve contribution based on a 30-year positive cash flow projection. Known as the 30-year "Pooled" or "Cash Flow" Funding Plan, it involves determining Reserve contributions aimed at balancing out the fluctuating annual expenses from the Reserve fund. By consolidating funds from initial balances, a yearly contribution rate is computed to ensure a consistent positive cash flow over the analysis period.

This methodology is a widely accepted, logical, factual, and mathematical basis for calculating Reserve contributions where the Reserve fund total balance at any one point in the projection can offset the expected annual expenditures from the Reserve fund, in perpetuity, on a year-over-year basis.

In this methodology, Reserve funds can only be collectively allocated (used) for purposes authorized under the categorical nature of the components identified within the pool as they become due.

Powered by HomeRun IQ Page 14 of 36



Cash-Flow Projection

Inflation: 2.50% | Calc: Inflation-Adjusted


YEAR	STARTING BALANCE	CONTRIBUTIONS	PERCENT CHANGE	INTEREST	SPECIAL ASSMNT	ADDTIONAL CAPITAL	EXPENDITURE FUTURE COST	ENDING BALANCE	PERCENT FUNDED	FULLY FUNDED BALANCE
2025-26	\$274,031	\$29,500	N/A	\$2,740	\$0	\$0	\$38,842	\$267,429	76.32%	\$350,407
2026-27	\$267,429	\$30,385	3.00%	\$2,674	\$0	\$0	\$1,990	\$298,499	77.62%	\$384,552
2027-28	\$298,499	\$31,297	3.00%	\$2,985	\$0	\$0	\$13,908	\$318,872	78.15%	\$408,012
2028-29	\$318,872	\$32,235	3.00%	\$3,189	\$0	\$0	\$2,091	\$352,205	79.17%	\$444,882
2029-30	\$352,205	\$33,203	3.00%	\$3,522	\$0	\$0	\$2,143	\$386,787	80.02%	\$483,341
2030-31	\$386,787	\$34,199	3.00%	\$3,868	\$0	\$0	\$182,234	\$242,619	72.17%	\$336,157
2031-32	\$242,619	\$35,225	3.00%	\$2,426	\$0	\$0	\$2,252	\$278,018	75.05%	\$370,463
2032-33	\$278,018	\$36,281	3.00%	\$2,780	\$0	\$0	\$22,446	\$294,634	76.40%	\$385,631
2033-34	\$294,634	\$37,370	3.00%	\$2,946	\$0	\$0	\$2,366	\$332,584	78.72%	\$422,482
2034-35	\$332,584	\$38,491	3.00%	\$3,326	\$0	\$0	\$2,425	\$371,975	80.70%	\$460,938
2035-36	\$371,975	\$39,646	3.00%	\$3,720	\$0	\$0	\$381,676	\$33,665	30.60%	\$110,014
2036-37	\$33,665	\$40,835	3.00%	\$337	\$0	\$0	\$2,547	\$72,289	51.77%	\$139,645
2037-38	\$72,289	\$42,060	3.00%	\$723	\$0	\$0	\$17,813	\$97,259	62.70%	\$155,106
2038-39	\$97,259	\$43,322	3.00%	\$973	\$0	\$0	\$2,676	\$138,877	74.18%	\$187,222

Powered by HomeRun IQ
Page 15 of 36

YEAR	STARTING BALANCE	CONTRIBUTIONS	PERCENT CHANGE	INTEREST	SPECIAL ASSMNT	ADDTIONAL CAPITAL	EXPENDITURE FUTURE COST	ENDING BALANCE	PERCENT FUNDED	FULLY FUNDED BALANCE
2039-40	\$138,877	\$44,621	3.00%	\$1,389	\$0	\$0	\$2,743	\$182,144	82.47%	\$220,851
2040-41	\$182,144	\$45,960	3.00%	\$1,821	\$0	\$0	\$2,812	\$227,114	88.70%	\$256,046
2041-42	\$227,114	\$47,339	3.00%	\$2,271	\$0	\$0	\$2,882	\$273,842	93.51%	\$292,857
2042-43	\$273,842	\$48,759	3.00%	\$2,738	\$0	\$0	\$28,721	\$296,618	97.28%	\$304,927
2043-44	\$296,618	\$50,222	3.00%	\$2,966	\$0	\$0	\$3,028	\$346,778	100.66%	\$344,503
2044-45	\$346,778	\$51,728	3.00%	\$3,468	\$0	\$0	\$3,104	\$398,871	103.37%	\$385,868
2045-46	\$398,871	\$53,280	3.00%	\$3,989	\$0	\$0	\$88,437	\$367,703	107.61%	\$341,697
2046-47	\$367,703	\$54,879	3.00%	\$3,677	\$0	\$0	\$3,261	\$422,997	109.97%	\$384,650
2047-48	\$422,997	\$56,525	3.00%	\$4,230	\$0	\$0	\$22,812	\$460,940	112.54%	\$409,584
2048-49	\$460,940	\$58,221	3.00%	\$4,609	\$0	\$0	\$3,426	\$520,345	114.12%	\$455,975
2049-50	\$520,345	\$59,967	3.00%	\$5,203	\$0	\$0	\$3,512	\$582,003	115.38%	\$504,431
2050-51	\$582,003	\$61,766	3.00%	\$5,820	\$0	\$0	\$85,693	\$563,897	119.75%	\$470,877
2051-52	\$563,897	\$63,619	3.00%	\$5,639	\$0	\$0	\$3,690	\$629,465	120.68%	\$521,581
2052-53	\$629,465	\$65,528	3.00%	\$6,295	\$0	\$0	\$36,782	\$664,506	122.90%	\$540,698
2053-54	\$664,506	\$67,494	3.00%	\$6,645	\$0	\$0	\$3,876	\$734,769	123.47%	\$595,118
2054-55	\$734,769	\$69,519	3.00%	\$7,348	\$0	\$0	\$3,973	\$807,662	123.89%	\$651,920

Powered by HomeRun IQ
Page 16 of 36



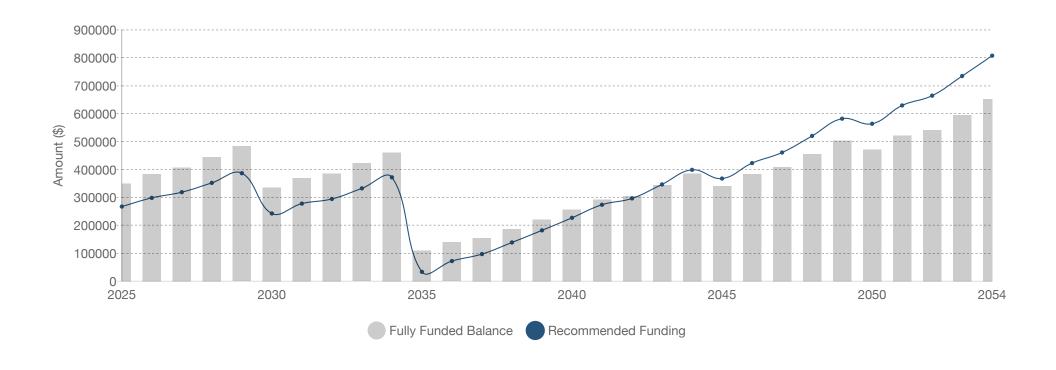

Powered by HomeRun IQ
Page 17 of 36



Funding Options

Significant expenses for repair or replacement of reserve components are expected within a community. When these expenses occur there are essentially four funding options available for addressing the expenditure:

- The First and most logical option for the Board of Directors is to ensure the association's ability to maintain the obligated assets by assessing an adequate level of reserves as part of the regular membership fees. This approach allows for the cost of replacements to be uniformly distributed among all members, both present and future. The board needs to avoid adopting a calculation method or funding plan that unfairly burdens future members to compensate for past reserve deficits. The board has a fiduciary responsibility to the entire community and should act in their best interest. By setting aside reserves over the lifespan of the asset, such as a roof, the association has ample time to accumulate the necessary funds. Additionally, these contributions would be evenly distributed among all members and could earn interest.
- The *Second option* is for the association to secure a loan from a lending institution to finance any immediately required repairs. In many cases, banks are willing to lend to associations using future homeowner assessments as collateral. However, this method commits the association's future assets and incurs additional expenses in the form of interest fees. For instance, in the case of a \$150,000 roofing replacement, the association may be required to repay the loan over three to five years, along with the accrued interest.
- The Third option is to pass a "special assessment" to the membership, requiring each member to contribute an amount necessary to cover the expenditure. When a special assessment is implemented, the association has the authority and responsibility to collect the assessments, even through foreclosure if necessary. However, it is important to note that there is no guarantee that an assessment will be passed when it is needed. Therefore, the association cannot ensure its ability to perform the required repairs or replacements for major components when the need arises. Furthermore, as communities age, the need for major reserve expenditures increases. Associations that are 12 to 15 years old or older often encounter numerous components reaching the end of their useful lives. If these required expenditures coincide, they can have a detrimental impact on the association's overall budget.
- The *Fourth option*, although not recommended, is to defer the necessary repair or replacement. This approach can lead to declining property values due to an expanding list of deferred maintenance items. The association may struggle to keep up with the natural aging process of common area components. Consequently, this can make it difficult, or even impossible, for potential buyers to obtain financing from lenders. Lending institutions are increasingly requesting copies of the association's most recent reserve study before granting loans, whether to the association itself, a

Powered by HomeRun IQ Page 18 of 36

prospective purchaser, or an individual within the association.

Powered by HomeRun IQ Page 19 of 36



Reserve Components

In this section of the report, we provide a comprehensive examination of the Reserve Study's physical analysis, encompassing a thorough inventory of the significant components within the association's "common" areas. This includes "Limited Common Elements" or (LCE).

Each Reserve Component has been assessed based on its physical condition during the inspection. A determination was made regarding the following:

- · Installation date
- · Estimated market expected lifespan
- · Subjective remaining lifespan
- · Unit current cost
- · Unit projected future cost

Powered by HomeRun IQ Page 20 of 36



Component List - Full Detail

SIRS and TRS Yearly Update

Basic Info

Type of Cost: Replacement

Location: General

Category:

Condition: Excellent

Comments/Notes

Based on CAI Reserve Study Standards study cost should be accounted for in the reserve study. This reflects a yearly update.

Useful Life

Last Activity Date:	01/01/2024
Est. Useful Life:	1y
Remaining Useful Life:	0y
Next Activity Date:	04/01/2025

Financial Data

Estimate Date:	01/01/2024
Cost Per LS:	\$1,848.00
Total Quantity:	1 LS
Total Current Cost:	\$1,894
Inflation Rate:	2.50%
Total Expenditures:	\$85,240

Powered by HomeRun IQ Page 21 of 36

001 - Asphalt Pavement, Mill & Overlay

Basic Info

Type of Cost: Replacement

Location: Property Site Components

Category: Ground Surfaces


Condition: Good

Useful Life

Last Activity Date:	04/01/2010
Est. Useful Life:	25y
Remaining Useful Life:	5y
Next Activity Date:	04/01/2030

Financial Data

01/01/2024
Xactimate
\$21.00
2,724 SY
\$58,634
2.50%
\$66,340

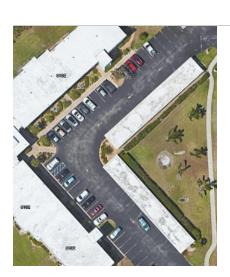

Powered by HomeRun IQ Page 22 of 36

002 - Asphalt Pavement, Patch, Stripe & Sealcoat

Basic Info

Type of Cost: Repairs & Maintenance
Location: Property Site Components
Category: Ground Surfaces
Condition: Good

Useful Life

Last Activity Date: 04/01/2022

Est. Useful Life: 5y

Remaining Useful Life: 2y

Next Activity Date: 04/01/2027

Financial Data

Estimate Date:	01/01/2024
Estimate Source:	Xactimate
Cost Per SF:	\$0.45
Total Quantity:	24,520 SF
Total Current Cost:	\$11,304
Inflation Rate:	2.50%
Total Expenditures:	\$99,184



Powered by HomeRun IQ Page 23 of 36

003 - Elevator Cabs, Refurbish Part 1

Basic Info

Type of Cost: Repairs & Maintenance
Location: Interior Building Components
Category: Mechanical
Condition: Good

Useful Life

Last Activity Date: 04/01/2018

Est. Useful Life: 20y

Remaining Useful Life: 0y

Next Activity Date: 04/01/2025

Financial Data

Estimate Date:	01/01/2024
Estimate Source:	MVS
Cost Per Ea:	\$36,000.00
Total Quantity:	1 Ea
Total Current Cost:	\$36,900
Inflation Rate:	2.50%
Total Expenditures:	\$97,365



Powered by HomeRun IQ Page 24 of 36

003 - Elevator Cabs, Refurbish Part 2

Basic Info

Type of Cost: Repairs & Maintenance
Location: Interior Building Components
Category: Mechanical
Condition: Good

Useful Life

Last Activity Date: 04/01/2018

Est. Useful Life: 20y

Remaining Useful Life: 5y

Next Activity Date: 04/01/2030

Financial Data		
Estimate Date:	01/01/2024	
Estimate Source:	MVS	
Cost Per Ea:	\$43,200.00	
Total Quantity:	1 Ea	
Total Current Cost:	\$44,280	
Inflation Rate:	2.50%	
Total Expenditures:	\$132,192	

Powered by HomeRun IQ Page 25 of 36

004 - Elevators, 3-Stop, Hydraulic, Modernization

Basic Info

Type of Cost: Repairs & Maintenance

Location: Building Service Components

Category: Mechanical

Condition: Good

Useful Life

Last Activity Date: 04/01/2008

Est. Useful Life: 36y

Remaining Useful Life: 10y

Next Activity Date: 04/01/2035

Financial Data

Estimate Date: 01/01/2024

Estimate Source: MVS

Cost Per Ea: \$190,000.00


Total Quantity: 1 Ea

Total Current Cost: \$194,750

Inflation Rate: 2.50%

Total Expenditures: \$249,296



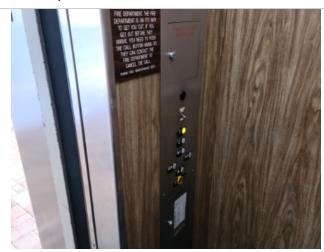

Powered by HomeRun IQ Page 26 of 36

005 - Furniture, Outdoor

Basic Info

Type of Cost: Replacement

Location: Property Site Components

Category: Furniture

Condition: Good

Useful Life

Last Activity Date: 04/01/2022

Est. Useful Life: 10y

Remaining Useful Life: 7y

Next Activity Date: 04/01/2032

Financial Data

Estimate Date: 01/01/2024

Estimate Source: Local Contractors

Cost Per Allow: \$5,500.00

Total Quantity: 1 Allow

Total Current Cost: \$5,638

Inflation Rate: 2.50%

Total Expenditures: \$26,260





Powered by HomeRun IQ Page 27 of 36

006 - Gutters & Downspouts, 6" Aluminum

Basic Info

Type of Cost: Replacement

Location: Exterior Building Components

Category: Weatherproofing

Condition: Good

Useful Life

Last Activity Date: 04/01/2007

Est. Useful Life: 30y

Remaining Useful Life: 5y

Next Activity Date: 04/01/2030

Financial Data

Estimate Date: 01/01/2024

Estimate Source: MVS

Cost Per LF: \$13.50

Total Quantity: 2,200 LF

Total Current Cost: \$30,444

Inflation Rate: 2.50%

Total Expenditures: \$34,443





Powered by HomeRun IQ Page 28 of 36

007 - Light Fixtures, Exterior

Basic Info

Type of Cost: Replacement

Location: Exterior Building Components

Category: Mechanical

Condition: Good

Useful Life

Last Activity Date: 04/01/2015


Est. Useful Life: 15y

Remaining Useful Life: 5y

Next Activity Date: 04/01/2030

Financial Data

Estimate Date:	01/01/2024
Estimate Source:	MVS
Cost Per Ea:	\$246.00
Total Quantity:	60 Ea
Total Current Cost:	\$15,129
Inflation Rate:	2.50%
Total Expenditures:	\$41,908

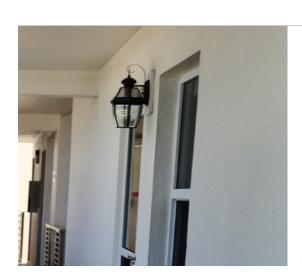

Powered by HomeRun IQ Page 29 of 36

008 - Mailbox Clusters, Aluminum, Multi-Tenant

Basic Info

Type of Cost: Replacement

Location: Property Site Components

Category: Mailboxes

Condition: Good

Useful Life

Last Activity Date: 04/01/2005

Est. Useful Life: 25y

Remaining Useful Life: 5y

Next Activity Date: 04/01/2030

Financial Data

Estimate Date: 01/01/2024

Estimate Source: USPS

Cost Per Ea: \$3,460.00

Total Quantity: 3 Ea

Total Current Cost: \$10,640

Inflation Rate: 2.50%

Total Expenditures: \$12,038





Powered by HomeRun IQ Page 30 of 36

010 - Pavers, Concrete, Walkways

Basic Info

Type of Cost: Replacement

Location: Property Site Components

Category: Ground Surfaces

Condition: Good

Useful Life

Last Activity Date: 04/01/2000

Est. Useful Life: 35y

Remaining Useful Life: 10y

Next Activity Date: 04/01/2035

Financial Data

Estimate Date: 01/01/2024

Estimate Source: XactRemodel


Cost Per SF: \$15.00


Total Quantity: 6,600 SF

Total Current Cost: \$101,475

Inflation Rate: 2.50%

Total Expenditures: \$129,895

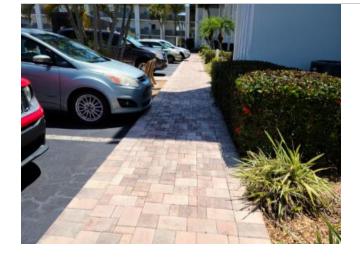

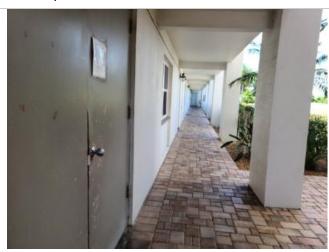

Powered by HomeRun IQ Page 31 of 36



Useful Definitions

Adjustment to Useful Life: The estimated useful life may be adjusted, up or down, by this separate figure for the current cycle of replacement. This allows for a current period adjustment without affecting the estimated replacement cycles for future replacements.

Annual Assessment Increase: This represents the percentage rate at which the association will increase its assessment to reserves at the end of each year. It ensures the accumulation of the desired amount over a specific timeframe.

Annual Fixed Reserves: An optional figure that, if used, will override the normal process of allocating reserves to each asset.

Budget Year Beginning/Ending: The fiscal year for which the report is prepared. Monthly contribution figures indicated are for the 12 months beginning on January 1st and ending on December 31st of a specific year for associations with a fiscal year ending on December 31st.

Component: A specific item or element that is part of the association's common area assets and requires reserve funding.

Component Inventory: The process of selecting and qualifying reserve components. This can be done through on-site visual inspections, reviewing association documents, considering established precedents, and consulting with relevant association representatives.

Cost per Unit: The estimated cost to replace a reserve component per unit of measurement.

Current Replacement Cost: The estimated cost of replacing the asset at the beginning of the fiscal year for which the report is prepared.

Estimated Remaining Life: A calculation based on the report's fiscal year date and the asset's placed-inservice date to determine the remaining life of the asset.

Estimated Useful Life: The anticipated lifespan of an asset based on industry standards, manufacturer specifications, visual inspection, location, usage, association standards, and prior history.

Future Replacement Cost: The estimated cost to repair or replace the asset at the end of its estimated useful life, based on the current replacement cost and inflation.

Group and Category: The report may be prepared and sorted either by group (location, building, phase, etc.) or by category (roofing, painting, etc.). The standard report printing format is by category.

Inflation: A figure used to estimate the future cost of repairing or replacing each component. The current cost of each component is compounded annually based on the number of remaining years to replacement, and the total is used to calculate the monthly reserve contribution needed to accumulate the required funds in time for replacement.

Powered by HomeRun IQ Page 32 of 36

Interest Contribution (After Taxes): The interest that should be earned on the reserves, net of taxes, based on their beginning reserve balance and monthly contributions for one year. This figure is averaged for budgeting purposes.



Investment Yield Before Taxes: The average interest rate anticipated by the association based on its current investment practices.

Number of Units and/or Phases: If applicable, the number of units and/or phases included in the report.

Percent Fully Funded: The ratio, at the beginning of the fiscal year, of the actual (or projected) reserve balance to the calculated fully funded balance, expressed as a percentage.

Phase Increment Detail and/or Age: Comments regarding the aging of the components based on the construction date or date of acceptance by the association.

Placed-In-Service Date: The month and year when the asset was placed in service, which could be the construction date, the first escrow closure date in a phase, or the date of the last servicing or replacement.

Projected Reserve Balance: The anticipated reserve balance on the first day of the fiscal year for which this report has been prepared. This is based on the provided information and is not audited.

Quantity: The amount or number of each reserve component element.

Replacement Year: The year when the asset is scheduled to be replaced. The necessary funds will be available by the first day of the fiscal year for which replacement is anticipated.

Reserves: Funds set aside for projected repairs and/or replacements of the association's common elements.

Salvage Value: The salvage value of the asset at the time of replacement, if applicable.

Total Monthly Allocation: The sum of the monthly assessment and interest contribution figures.

Units: The unit of measurement used for each quantity.

Estimated Replacement Cost: The estimated cost to repair or replace the asset at the end of its estimated useful life based on the current replacement cost and inflation.

Monthly Assessment: The assessment to reserves required by the association each month.

Taxes on Interest Yield: The estimated percentage of interest income that will be set aside to pay income taxes on the earned interest.

Total Monthly Allocation: The sum of the monthly assessment and interest contribution figures.

Unit Abbreviations:

Sq Ft - Square Feet Sq Yds - Square Yards Ln Ft - Linear Feet

Cu Ft - Cubic Feet Cu Yds - Cubic Yards Opngs - Openings (elevators)

Powered by HomeRun IQ Page 33 of 36

Lp Sm - Lump Sum Allow - Allowance Hp - Horsepower

Units - Units Ct - Court Bldg- Building

Ea - Each Kw - Kilowatts Sq - Squares (1 Sq = 100 sq ft)

Powered by HomeRun IQ Page 34 of 36



Disclosures

Seven Lakes Golf and Tennis Community Condo 46 contracted with Stone Building Solutions to conduct a Reserve Study. Stone Building Solutions completed the site review and has conducted interviews with the building engineer, ownership group, and property manager in an attempt to evaluate the physical condition of the various components and their maintenance schedules, as well as to obtain information related to any previous defects that may exist and any repairs that have been performed.

Stone Building Solutions has no present or prospective interest in the subject property of this report and also has no personal interest concerning the parties involved. Our assignment was not contingent upon producing or reporting predetermined results and our compensation is not contingent on any action or event resulting from this report.

The calculations, projections, and reports in this reserve study were generated using our state-of-the-art Reserve Study software. Our software has received a Quality Assurance Evaluation from a Certified Public Accounting firm verifying the system for accuracy and compliance with the American Institute of CPAs Audit and Accounting Guide for Common Interest Realty Associations, cash flow projections, and tax calculations consistent with IRS guidelines for 1120c and 1120h corporations.

This reserve analysis study and the parameters under which it has been completed are based upon information provided to us in part by representatives of the association, its contractors, assorted vendors, specialist and independent contractors, the Community Association Institute, and various construction pricing and scheduling manuals including, but not limited to: Marshall & Swift Valuation Service, RS Means Facilities Maintenance & Repair Cost Data, RS Means Repair & Remodeling Cost Data, National Construction Estimator, National Repair & Remodel Estimator, Dodge Cost Manual and McGraw-Hill Professional. Additionally, costs are obtained from numerous vendor catalogs, actual quotations or historical costs, and our own experience in the field of replacement cost valuation, insurance adjusting, and reserve study preparation.

This reserve analysis study is provided as an aid for planning purposes and not as an accounting tool. Since it deals with events yet to take place, there is no assurance that the results enumerated within it will occur as described.

Powered by HomeRun IQ Page 35 of 36



Annual Update Requirements

We recommend updating this study yearly, no longer than every 3 years.

Inflation, labor rates, material availability, taxes, insurance, and asset lives are just but a few of the ever-changing variables addressed in your reserve study report.

To order an updated study, please contact us at (800) 892-1116, or email us at reserves@stonebldg.com.

Powered by HomeRun IQ Page 36 of 36